
Customer Customer reference		Control Motor - Squirrel Cage Dealers Industrial Equipment 800-469-3110 O3018OT3P286T-W40					
Product line		: W40 NEMA Premium Efficiency Product code : 14501153 Three-Phase					
		The	e-Filase		Catalog # :	03018OT3P	286T-W40
Frame Output Poles		: 284 : 30 : 4	/6T HP (22 kW)	Locked rotor time Temperature rise Duty cycle	: 32s (cold) : 80 K : Cont.(S1)	18s (hot)
Frequency		: 60			Ambient temperature	: -20°C to +	
Rated voltage Rated current		: 200 : 80.:			Altitude Protection degree	: 1000 m.a.: : IP23	s.l.
L. R. Amperes		: 530			Cooling method	: IC01 - OD	Р
LRC			x(Code G)		Mounting	: F-1	
No load current		: 33.3 A : 1770 rpm			Rotation ¹ Noise level ²	: Both (CW : 64.0 dB(A)	
Rated speed Slip		: 1.67 %		Starting method	: Direct On		
Rated torque		: 87.8 ft.lb		Approx. weight ³	: 398 lb	-	
Locked rotor tor		: 280					
Breakdown torque Insulation class		: 280 % : F					
Service factor		: 1.25					
Moment of inertia (J)		: 4.52 sq.ft.lb : B					
Design	25%		75%	100%	Foundation loads		
Output Efficiency (%)	93.4	50% 93.6	94.1	94.1	Max. traction		
Power Factor	0.44	0.70	0.80	0.84	Max. compression		
				e end	Non drive		
Bearing type Sealing		:	: 6311 Z C3 6211 Z C : Without Bearing Seal Without Bearin				
Lubrication interval		:		1000 h	Without Bearing Seal 20000 h		
Lubricant amount		: 18 g			11 g		
Lubricant type		:			bil Polyrex EM		
	n http://dea	llerselectri	c.com	INIC			
Notes downloaded from This revision rep must be eliminate (1) Looking the n (2) Measured at (3) Approximate	laces and o ed. notor from 1m and wit	cancel the the shaft e	previous c end. ce of +3dB(ne, which A).	These are average valu power supply, subject to MG-1.		
downloaded from This revision rep must be eliminate (1) Looking the n (2) Measured at	laces and ed. notor from 1m and wit weight sub rocess.	cancel the the shaft e th toleranc oject to cha	previous c end. ce of +3dB(one, which A).	These are average valu power supply, subject to	o the tolerances stipul	
downloaded from This revision rep must be eliminate (1) Looking the n (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu	laces and ed. notor from 1m and wit weight sub rocess.	cancel the the shaft e th toleranc oject to cha	previous c end. e of +3dB(anges after	one, which A).	These are average valu power supply, subject to MG-1.	o the tolerances stipul	lated in NEMA
downloaded from This revision rep must be eliminate (1) Looking the n (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu	laces and ed. notor from 1m and wit weight sub rocess.	cancel the the shaft e th toleranc oject to cha	previous c end. e of +3dB(anges after	one, which A).	These are average valu power supply, subject to MG-1.	o the tolerances stipul	lated in NEMA
downloaded from This revision rep must be eliminate (1) Looking the n (2) Measured at (3) Approximate manufacturing pr (4) At 100% of fu Rev.	laces and ed. notor from 1m and wit weight sub rocess.	cancel the the shaft e th toleranc oject to cha	previous c end. e of +3dB(anges after	one, which A).	These are average valu power supply, subject to MG-1.	o the tolerances stipul	lated in NEMA

This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A. Subject to change without notice



This document is exclusive property of WEG S/A. Reprinting is not allowed without written authorization of WEG S/A. Subject to change without notice

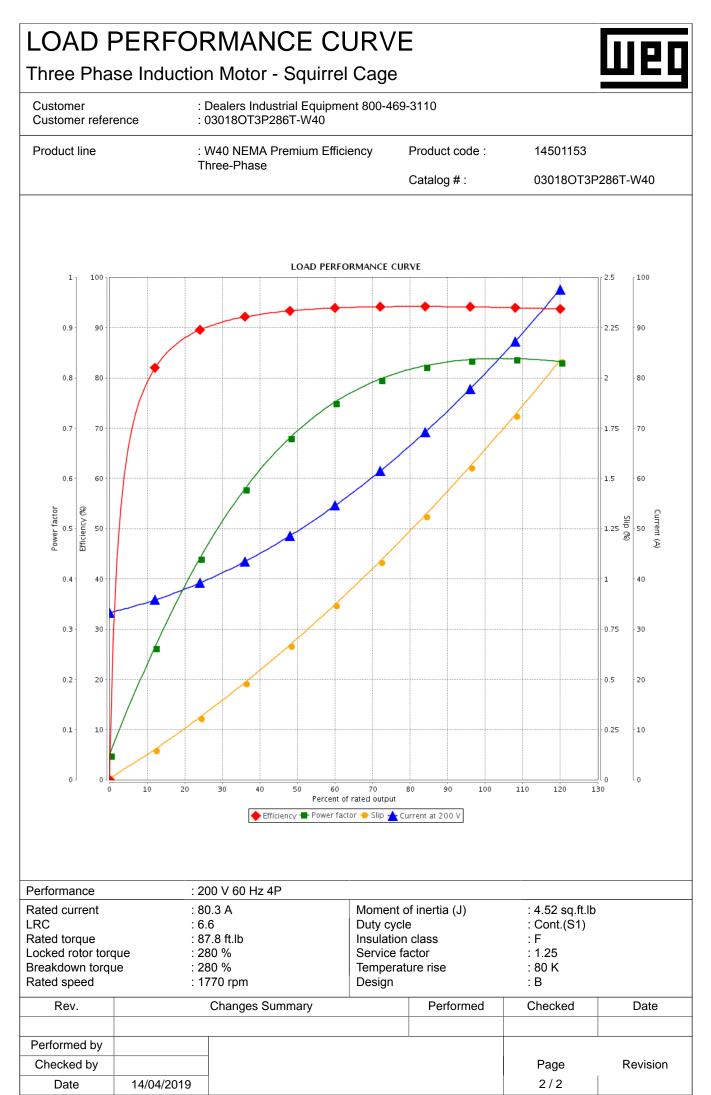